


MONUMENT RECORD

Corner ID: **CICr_E09-.5**



West-West 1/64 Corner

Sections 08 & 17- T07N-R01W, 2nd P.M.
Clear Creek Township, Monroe County, Indiana

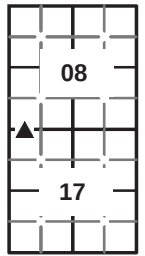

MONUMENT: Describe monument set or found (Include material type, scribing, distance above/below grade, dimensions.)
4" x 5" cut limestone with no markings found 0.25' above grade

MONUMENT LOCATION SKETCH:

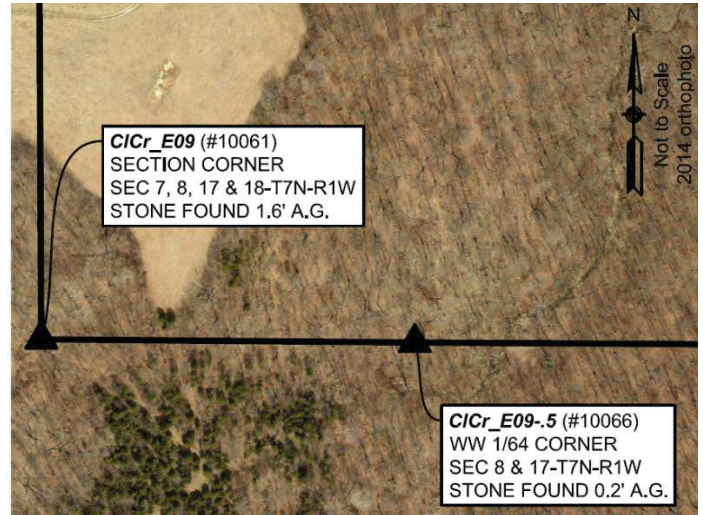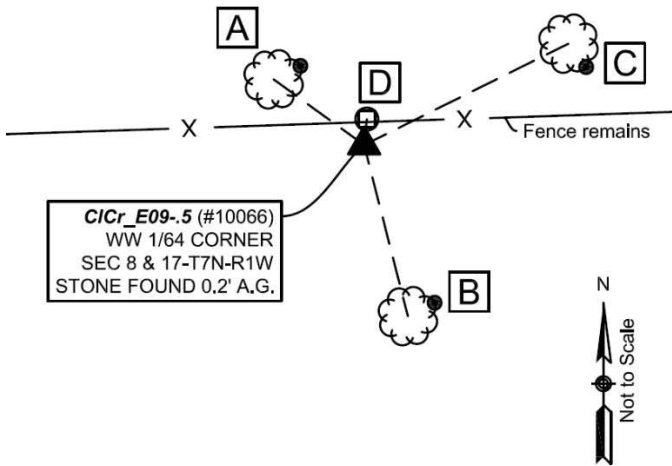

WITNESS MONUMENT TIES: Describe at least three new BT's and/or witness objects established or work done to preserve existing evidence. All ties to new Bearing Trees (BTs) are a mag nail set in a 1-1/2" plastic washer stamped "SURVEY MARKER - DO NOT REMOVE" and hack mark at the root crown (less than 12" above ground) perpendicular to the center of the tree, unless otherwise noted. BT diameters are noted as dbh and are measured approximately 4.5' above ground. Bearings are measured from the monument to the center of the BT, distances are measured from the monument to the mag nail. Distances to witness ties were measured with a Leica Disto laser distance meter. Bearings were collected with the internal magnetic compass of the Javad Triumph LS and were automatically adjusted to grid north.

ID	Bearing	Distance	Description
A	N 55° W	9.7'	Mag nail and washer set in hack 1.3' above grade on the east side of a 12" maple
B	S 15° E	15.4'	Mag nail and washer set in hack 0.3' above grade in the northeast root of a 7" white oak
C	N 63° E	19.8'	Mag nail and washer set in hack 0.6' above grade in the south root of a 22" maple
D	N 5° E	2.25'	T-post found

Notes:

PHOTO IDENTIFIED: Photo Date: 4/5/2018



Photo Orientation & Description: CICr_E09-.5



Photo Orientation & Description: Looking south at CICr_E09-.5



OFFICE OF THE MONROE COUNTY SURVEYOR • Trohn Enright-Randolph

119 W 7th Street, Bloomington, IN 47404 • 812-349-2570 • surveyoroffice@co.monroe.in.us

Page 1 of 3

MONUMENT RECORD

Corner ID: **ClCr_E09-.5**

West-West 1/64 Corner

Sections 08 & 17- T07N-R01W, 2nd P.M.
Clear Creek Township, Monroe County, Indiana

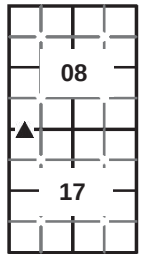


Photo Orientation & Description: Looking north at ClCr_E09-.5



Photo Orientation & Description: Looking east at ClCr_E09-.5

FIELD PERSONNEL:

Field Date: 4/5/2019 & 2/15/2019 By: R.Oser & E.Smithram Project #: T07NR01W08 Field Book: 51/63 & 52/79 Notes:

EXISTING SURVEY HISTORY Include as much detail and history of the corner as known at the time of perpetuation

ORIGINAL GOVERNMENT SURVEY:

Year Surveyed: Not an original corner By:
Where filed or recorded:
Original monument:
Bearing Trees or Reference Monuments:
Notes:

SUBSEQUENT CORNER RESTORATION:

Date Surveyed: No legal survey records found By:
Where filed or recorded:
Original monument:
Bearing Trees or Reference Monuments:
Notes:

ORIGINAL OR SUBSEQUENT SURVEY EVIDENCE FOUND: Include, search area or areas, search procedure, etc.

Date of Search: 4/5/2018 By: R.Oser & E.Smithram Monument Found: Cut limestone BTs or Reference Objects Found: We came across this stone while walking to ClCr_F09 Notes:

OTHER SURVEY HISTORY: Include details such as surveyor name, date, recording info, monument description, etc.
No survey history found.

OTHER EVIDENCE: Describe corner location relative to nearby features and how to reach the corner location – note fences, roads, timber cutting lines, mow lines, clearings, plantings, streams, topo changes, etc.

The stone is 2.0' south of east/west barbed wire fence remains in a fairly open woods

MONUMENT PRESERVATION: Describe work done to preserve existing monument.

We set a five-foot t-post 0.35' south of the stone with a Monroe County "PROTECT NEARBY SURVEY MARKER" sign attached 3.0' above grade facing north. We tested the stone with hydrochloric acid to confirm the presence of carbonate minerals before we tied orange flagging around it and spray painted it orange.

THEORY OF LOCATION: Describe the theory of location for acceptance of this monument. Include monument origin and associated uncertainty.

The origin of this stone is unknown. It appears to have been set on the split between the stone found at the southwest corner of Section 8 and the stone found at the southeast corner of the southwest quarter of the southwest quarter of Section 8. It was accepted as the best evidence of the corner with no associated uncertainty.

GEODETIC COORDINATES: Northing: 1384899', Easting: 3103750'

BASIS OF GEODETIC COORDINATES: The basis of bearings is Grid North System NAD83 (2011)/Indiana West NAVD 88, Epoch 2010.0000, geoid12b_conus.db3, US Survey Feet. Tied to NSRS using the JAVAD GNSS Data Online Processing Service (DPOS) to post-process static observations collected with a Javad Triumph 2 base. Positional values of this corner were determined from static GNSS and RTK GNSS (Javad Triumph LS Rover) observation.

This document is not complete without the associated Corner Perpetuation plat and report of survey for Section 08-T07N-R01W by



OFFICE OF THE MONROE COUNTY SURVEYOR • Trohn Enright-Randolph

119 W 7th Street, Bloomington, IN 47404 • 812-349-2570 • surveyoroffice@co.monroe.in.us


Page 2 of 3

MONUMENT RECORD

Corner ID: **CICr_E09-.5**

West-West 1/64 Corner

Sections 08 & 17- T07N-R01W, 2nd P.M.
Clear Creek Township, Monroe County, Indiana

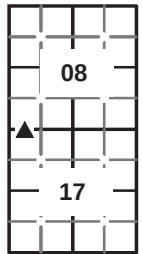

Rachel Oser of the Monroe County Surveyor's Office dated April 15, 2019 and recorded as Instrument Number 2019004835 in the office of the Monroe County Recorder.

CERTIFICATIONS:



Rachel Oser

Date: 4/16/2019
Rachel Oser, State of Indiana
Professional Surveyor
No.21100022



Trohn Enright-Randolph

Date: 4/16/2019
Trohn Enright-Randolph
Monroe County Surveyor



Accepted by the Monroe
County Surveyor Review
Board on 4/16/2019

